OUT57753

1966 FEB 15 02 11Z

S E C R E T 150201Z

25X1

- 1. CAMERA B 23 WAS USED IN MISSION 8074 FLOWN ON 11
 FEBRUARY 1966. PROCESSING WAS ACCOMPLISHED BY NAV RECON TECH
 SUPPCEN.
 - 2. ORIGINAL NEGATIVE:
- A. THE EXPOSURE WAS ADEQUATE AND THE RESOLUTION IS

 FAIR TO GOOD. RESOLUTION THROUGHOUT THE MISSION IS DEGRADED

 BY WHAT APPEARS TO BE TWO SEPARATE ANOMOLIES. FIRST, THE AREA

 OF OPTIMUM FOCUS IS LOCATED AT THE NON-DATA CHAMBER END OF ALL

 FRAMES RATHER THAN IN THE CENTER OF THE FORMAT ALONG THE INBOARD

 EDGE. THE IMAGERY AT THE DATA CHAMBER END IS SLIGHTLY OUT-OF
 FOCUS. THE TRANSITION FROM GOOD FOCUS AT THE NON-DATA CHAMBER

 END TO OUT-OF-FOCUS AT THE DATA CHAMBER END IS GRADUAL AND GIVES

 THE APPEARANCE THAT THE MIRROR OR PLATEN MAY BE SLIGHTLY OUT OF

 ALIGNMENT. SECOND, THE QUALITY OF THE IMAGERY EXPOSED IN THE

 IR AND IL POSITIONS HAS A SOFT APPEARANCE WHICH IS NON-DIRECTIONAL

 AND MAY POSSIBLY BE CAUSED BY A HIGH FREQUENCY VIBRATION OR A

 MORE SEVERE ALIGNMENT PROBLEM PRESENT IN THESE POSITIONS.

 THE RESOLUTION OF PHOTOGRAPHY TAKEN IN THE 2R AND 2L POSITIONS

 IS BETTER THAN THAT TAKEN IN THE 1R AND 1L POSITIONS.
- B. 9R SIDE: INBOARD AND OUTBOARD ROLLER CHATTER ARE PRESENT THROUGHOUT THE MISSION. SLIGHT EDGE STATIC IS PRESENT

15 FFP 1966

"SINIPATION Action

ACTIO

Advance COPY

Sanitized

SECRET

ALONG THE OUTBOARD EDGE OF THE FILM FROM HEAD TO TAIL. CHEMICAL STAINS ON THE BASE SIDE OF THE MATERIAL ARE PRESENT ON FRAMES 1977 THROUGH 1897. THESE APPEAR TO HAVE BEEN CAUSED BY FOREIGN MATTER ON A ROLLER EITHER DURING FILM MANUFACTURE OR FILM PROCESSING. FRAME 810 CONTAINS A MANUFACTURER'S SPLICE AND HEAT SPLICES ARE LOCATED IN FRAME 1187 AND BETWEEN FRAMES 303/304, 603/604. 804/805. 1504/1505 AND 1558/1559.

- C. 9L SIDE: INBOARD ROLLER CHATTER IS PRESENT FROM
 HEAD TO TAIL. OUTBOARD EDGE STATIC AND INBOARD EDGE FOG ARE
 PRESENT THROUGHOUT THE MISSION. A PLUS DENSITY STREAK CAUSED
 BY A CREASE IN THE FILM IS LOCATED THROUGH THE MIDDLE OF
 FRAMES 498 THROUGH 502. A MANUFACTURER'S SPLICE IS CONTAINED
 IN FRAME 173 AND HEAT SPLICES ARE LOCATED IN FRAME 1063 AND
 BETWEEN FRAMES 303/304, 304/305, 603/604, 1003/1004, 1204/1205,
 1504/1505 AND 1551/1552.
- D. BOTH SIDES: THE DATA CHAMBER COUNTER RECORDED FRAME NUMBER 0001 TWO TIMES; FRAME NUMBER 0230 FOUR TIMES AND FRAME NUMBER 1130 TWICE. THE FOCUS CONDITION DESCRIBED IN PART 2A APPLIES TO BOTH SIDES OF THE MISSION. THE FIRST TITLED FRAME IS 0001 AND THE LAST TITLED FRAME IS 2205.
- E. THERE WERE NO MAJOR PROCESSING ANOMALIES OR CAMERA MALFUNCTIONS OTHER THAN THOSE PREVIOUSLY MENTIONED.
 - 3. POSITIVE:
 - A. PI SUITABILITY IS FAIR TO GOOD.
 - B. PRINTING AND PROCESSING WERE GOOD.

C. CLOUDS DEGRADE OR OBSCURE APPROXIMATELY 30 PERCENT OF THE MISSION.

SECRET

/END OF MESSAGE/